

N00158.AR.000474
NASJRB WILLOW GROVE
5090.3a

FINAL TASK SPECIFIC PLAN BUILDING 20 SLAB SCOPING SURVEY NAS WILLOW GROVE
PA
10/1/2014
TETRA TECH INC



Final

**Task Specific Plan
Building 20 Slab
Scoping Survey**

**Naval Air Station Joint Reserve Base
Willow Grove
Horsham, Pennsylvania**

October 2014

Prepared for:

**Department of the Navy
Base Realignment and Closure
Program Management Office East
Philadelphia, Pennsylvania**

Prepared by:

**Tetra Tech, Inc.
661 Anderson Drive, Suite 5
Pittsburgh, Pennsylvania**

Prepared under:

**Naval Facilities Engineering Command
Contract Number: N62470-08-D-1001
Task Order: WE42**

Contract Number: N62470-08-D-1001
Task Order: WE42

FINAL

**TASK SPECIFIC PLAN
BUILDING 20 SLAB
SCOPING SURVEY**


**NAVAL AIR STATION JOINT RESERVE BASE
WILLOW GROVE
HORSHAM, PENNSYLVANIA**

October 2014

Contract Task Order WE42

**Prepared for:
Department of the Navy
Base Realignment and Closure
Program Management Office East
Philadelphia, Pennsylvania**

REVIEW AND APPROVAL

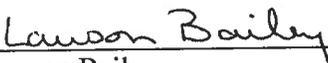

Lawson Bailey
Project Manager



Willington Lin
BRAC Environmental Coordinator

TABLE OF CONTENTS

REVIEW AND APPROVAL	i
<i>ACRONYMS AND ABBREVIATIONS</i>	iv
1.0 INTRODUCTION	1
1.1. SITE DESCRIPTION AND HISTORICAL SUMMARY	1
2.0 SURVEY DESCRIPTION.....	1
2.1 SURVEY PREPARATION AND REMEDIATION ACTIVITIES.....	2
2.2 RELEASE CRITERIA	2
2.3 REFERENCE AREA	2
2.4 INVESTIGATION LEVELS.....	3
2.5 SURVEY UNITS AND CLASSIFICATION	3
2.6 ESTABLISHING THE NUMBER OF MEASUREMENTS	3
2.7 ALPHA AND BETA SCAN MEASUREMENTS	4
2.7.1 Alpha Scan Measurements.....	5
2.7.2 Beta Scan Measurements	6
2.8 ALPHA AND BETA STATIC MEASUREMENTS	7
2.8.1 Alpha Static Measurements	8
2.8.2 Beta Static Measurements.....	9
2.9 GAMMA WALKOVER SURVEYS	10
2.10 REMOVABLE CONTAMINATION SURVEYS	10
2.11 MEDIA SAMPLES	10
3.0 SITE RESTORATION	11
4.0 BUILDING 20 SLAB REPORT.....	11
5.0 QUALITY CONTROL.....	11
6.0 ENVIRONMENTAL PROTECTION.....	11
7.0 REFERENCES	12

ATTACHMENT

Attachment 1 – Surface Contamination Monitor/Survey Information Management System Compliance with RASO Guidance Document for Conducting Alpha Scans for Radium, Millennium Services, Inc., May, 2014

LIST OF FIGURES

FIGURE 1 BUILDING 20 SITE LOCATION14

FIGURE 2 BUILDING 20 CLASSIFICATIONS AND SURVEY UNITS15

FIGURE 3 BUILDING 20 SURVEY UNIT 116

LIST OF TABLES

TABLE 1 BUILDING 20 SLAB APPLICABLE STANDARD OPERATING PROCEDURES.....18

TABLE 2 BUILDING 20 SLAB PRIMARY RADIATION PROPERTIES AND RELEASE CRITERIA FOR RADIONUCLIDES OF CONCERN19

TABLE 3 SUMMARY OF DATA QUALITY OBJECTIVES20

TABLE 4 DEFINABLE FEATURES OF WORK FOR RADIOLOGICAL SURVEYS21

ACRONYMS AND ABBREVIATIONS

α	Alpha
β	Beta
ϵ_i	Instrument efficiency
ϵ_s	Contaminated surface efficiency
B	Background count rate
b_i	Number of background counts in scan time interval
d'	Index of sensitivity
E	Detector efficiency
G	Source activity
i	Scan or observation interval
ρ or P	Probability
p	Surveyor efficiency factor
R_B	Background count rate
t	Time interval of detector over source
T_B	Background counting time
T_{S+B}	Sample counting time
W_A	Area of the detector window
$Z_{1-\alpha}$	Type I decision error level
$Z_{1-\beta}$	Type II decision error level
cm	Centimeter
cm ²	Square centimeter
cm/sec	Centimeter per second
cpm	Count per minute
dpm	Disintegration per minute
DFW	Definable features of work
ft ²	Square feet
HASP	Health and Safety Plan
HRA	Historical Radiological Assessment
inch/sec	Inch per second
JRB	Joint Reserve Base
LBGR	Lower bound of the gray region
MARSSIM	Multi-Agency Radiation Survey and Site Investigation Manual
MDC	Minimum detectable concentration

ACRONYMS AND ABBREVIATIONS (CONTINUED)

MDCR	Minimum detectable count rate
min	Minute
N	Number of data points
NAS	Naval Air Station
NRC	Nuclear Regulatory Commission
PSPC	Position sensitive proportional counter
RASO	Radiological Affairs Support Office
Ra-226	Radium 226
ROC	Radionuclides of concern
SCM	Surface contamination monitor
sec	Second
SIMS	Survey Information Management System
SOP	Standard operating procedure
Sr-90	Strontium 90
TSP	Task specific plan

1.0 INTRODUCTION

This task specific plan (TSP) provides task-specific details for the scoping survey at Building 20 Slab at the Willow Grove Naval Air Station (NAS) Joint Reserve Base (JRB) in Horsham, Pennsylvania. The survey will be conducted in accordance with the general approach and methodologies that are given in the Basewide Radiological Management Plan at Naval Air Station Joint Reserve Base, Willow Grove (TetraTech 2014a) and standard operating procedures (SOP). The surveys will conform to the requirements of the Health and Safety Plan (HASP) Naval Air Station Joint Reserve Base, Willow Grove (TetraTech 2014b) prepared for the survey program. No exceptions to the management plan, SOPs, and HASP are noted.

1.1. SITE DESCRIPTION AND HISTORICAL SUMMARY

Hangar 20 was in use at the Pitcairn airfield when it was purchased by the Navy and was one of the original hangars used at NAS JRB Willow Grove after commissioning. The building housed several groups during its years of use, including Assembly and Repair, Avionics Division, Parachute and Survival Equipment Shop, Non-Destructive Inspection (NDI) Shop, ASW Marine Aircraft Group (MAG 49), and the GSE Ordnance Shop. The approximately 16,524-square foot wooden hangar was built on a concrete slab and contained sumps for the disposal of oil and solvents. According to site photographs, the building was demolished between 1978 and 1981. However, a demolition drawing was created in 1992 for this building. This drawing shows the operational portions of the building to be eight shop areas, one storage area, and the main hangar bay. A 2006 photograph shows a temporary hangar was placed over a portion of the footprint, which was used by a local flying club. Some concrete surface from the original building remains in the area where the building once stood, but it does not appear to represent the entire original footprint.

Many types of aircraft have components containing radioactive material. Aircraft that were potentially housed and repaired in this building between 1942 and 1975 and their associated radioisotopes are listed in Table 6-1 of the HRA (TetraTech 2013). Table 4-2 of the HRA (TetraTech 2013) also lists aircraft components containing radioactive material. Additionally, radioluminescent items were used in survival equipment and would have been housed and handled in this hangar. Examples of radioactive materials possibly used in this building are aircraft parts and self-illuminating instrumentation, compasses, and personnel markers. The specific radionuclides of concern (ROC) identified in the Historical Radiological Assessment (HRA) (TetraTech 2013) are strontium 90 (Sr-90) and radium 226 (Ra-226). Figure 1 provides the location of Building 20 Slab on the NAS JRB Willow Grove site.

2.0 SURVEY DESCRIPTION

This survey is being performed to assess if residual activity is above the established release criteria, as defined in Table 6-1 of the Management Plan (TetraTech 2014a). Surveys of the facility will be performed to determine the existence of radionuclides associated with the storage of aircraft parts, self-illuminating instruments and markers. Surveys will be performed for the presence of Sr-90 and Ra-226.

Alpha surveys will be performed to determine compliance with release criteria for Ra-226. Due to the extremely low number of counts in the Surface Contamination Monitor (SCM) survey interval associated with the release criteria, positive indications for alpha surveys will be based on exceeding a threshold value in both a primary and recount detector in a 100 cm² area. Areas that exceed the investigation criteria based on the activity level determined by the SCM will be investigated.

Beta surveys will be performed to determine compliance with the release criteria for Sr-90.

Swipe surveys will be obtained at predetermined locations. Swipes will be analyzed onsite for both alpha and beta emitting radionuclides.

100% gamma walkover surveys will be performed in accordance with SUR-022, Gamma Walkover Surveys in each survey unit to provide additional assurance that no hidden sources of radioactivity exist in the survey unit area.

2.1 SURVEY PREPARATION ACTIVITIES

Survey area preparation activities will be performed under radiological controls established in the SOPs. A listing of applicable SOPs for both preparation and survey activities is provided in [Table 1](#). Surveys conducted in support of area preparation activities can provide input into final reports, but will not be used to demonstrate compliance with the release criteria or determination for additional survey requirements.

2.2 RELEASE CRITERIA

The building surface release criteria for Ra-226 is 100 disintegrations per minute (dpm) per 100 square centimeters (cm²) total activity, and for Sr-90 it is 1,000 dpm/100 cm² ([TetraTech 2014a](#)). The removable contamination release criteria is one-fifth of the total activity limits ([TetraTech 2014a](#)). The limits for the specific radionuclides to be addressed on the Building 20 Slab are provided in [Table 2](#). Alpha surveys will be performed to meet the criteria for Ra-226. Beta surveys will be performed to meet the criteria for Sr-90.

2.3 REFERENCE AREA

The reference area will be selected with the concurrence of Navy Radiological Affairs Support Office (RASO). The reference areas for the Building 20 Slab survey will consist of concrete floors. The reference materials will be identified in on-site buildings that have no history of containing radioactive material. The reference area survey data will be obtained prior to final recording of surveys on the Building 20 Slab and will be included in the Building 20 Slab survey report.

2.4 INVESTIGATION LEVELS

Investigation levels for the alpha and beta surveys will be equal to the release criteria in [Section 2.2](#) for the more restrictive isotope of concern in each area to be surveyed. For gamma walkover surveys, areas exceeding 3 sigma (3σ) above the mean of the survey unit will be investigated. Investigations of alpha or beta surveys may consist of resurveys with longer count times, determination of background adequacy or other means to determine if compliance with release criteria is achieved. Gamma walkover survey investigations will consist of resurveys of the area in which the high reading was obtained to determine the source of the elevated reading or if the reading was a statistical anomaly since approximately 1 percent of all readings will exceed the 3σ value.

2.5 SURVEY UNITS AND CLASSIFICATION

The Building 20 Slab will be surveyed as Class 3, requiring a 25 percent survey of floors. The total surface area of the Building 20 Slab is 16,525 square feet or 1,537 square meters. The building will be surveyed as a single survey unit. A layout drawing indicating building slab dimensions and survey unit locations is provided as [Figure 2](#). Using a random start point, systematic data collection locations (N) will be laid out in a triangular grid pattern for the survey units using the computer process provided by Visual Sample Plan (DOE 2014). In some cases, the number of data collection locations may exceed N based on the random location of the start point. Locations for data collection are provided in [Figure 3](#). Additional biased surveys may be performed and samples may be collected at low areas or drains.

2.6 ESTABLISHING THE NUMBER OF MEASUREMENTS

To determine the number of measurements, N, to be taken per survey unit when the contaminant is not present in background, Equation 5-3 of the management plan ([TetraTech 2014a](#)) is used:

$$N = \left(\frac{(Z_{1-\alpha} + Z_{1-\beta})^2}{4(\text{Sign } \rho - 0.5)^2} \right) (1.2)$$

Where:

N = Number of data points

$Z_{1-\alpha}$ = Type I decision error level, 1.645

$Z_{1-\beta}$ = Type II decision error level, 1.645

$\text{Sign } \rho$ = random measurement probability, 0.945201

1.2 = 20 percent increase in number of samples over the minimum

The values used in the calculation are from Multi-Agency Radiation Survey and Site Investigation Manual (MARSSIM) guidance ([Nuclear Regulatory Commission \[NRC\] 2000](#)) and are based on a recommended value for the relative shift (Δ/σ) of 1.6 as discussed in

Section 5.5.2.2 of MARSSIM (NRC 2000). Type I and Type II decision errors are based on 0.05 false negative and 0.05 false positive rates. The associated Z values are obtained from MARSSIM Table 5.2 (NRC 2000). The random measurement probability, Sign ρ , is from MARSSIM Table 5.4 (NRC 2000).

Using the defined values, the equation becomes:

$$N = \left(\frac{(1.645 + 1.645)^2}{4(0.945201 - 0.5)^2} \right) (1.2)$$

The calculation results in a value of $N = 16.38328$. Therefore, a minimum of 17 measurements will be obtained in each survey unit.

2.7 ALPHA AND BETA SCAN MEASUREMENTS

Scan measurements are performed to identify elevated areas of radioactivity within the survey unit. Alpha scans will be effective for identifying elevated concentrations of Ra-226. Beta scans will be effective for identifying elevated concentrations of SR-90. Twenty five percent of floor surfaces the Class 3 survey units will be scanned with the SCM. Based on the identified ROCs, the survey unit on the Building 20 Slab will be surveyed for alpha and beta activity. All scan surveys will be performed using the SCM. SCM scan surveys will be conducted in the dynamic, or “rolling” mode. Alpha scan measurements are discussed in Section 2.7.1. If adequate area is not available to the SCM in the dynamic mode, surveys may be supplemented by the SCM in the static mode discussed in Section 2.8.1. Beta scan measurements are discussed in Section 2.7.2. If adequate area is not available to the SCM in the dynamic mode, surveys may be supplemented by the SCM in the static mode discussed in Section 2.8.2.

The SCM utilizes a gas flow position sensitive proportional counter (PSPC). The PSPC functions as any gas flow proportional counter, using P-10 as the counting gas. As in any proportional counter, voltage plateaus are established for the detection of alpha or alpha plus beta particles. High voltage appropriate for the type of particles to be detected is applied to the single anode wire which runs the length of the detector. The SCM computer compares the pulse heights of pulses sensed at each end of the anode wire and establishes the location on the anode wire where the pulsed was sensed. Although the available resolution is greater than 2,000 locations on the anode wire, the SCM computer will “bin” the data in 5 centimeters (cm) wide increments along the length of the wire.

The SCM can be operated in both a dynamic or “rolling” mode or a static or “corner” mode. In the dynamic mode, the system uses a direct current powered drive motor affixed to a cart which contains all electronics and computer hardware, and a detector (or two) is mounted to the front of the cart. The SCM’s design focuses on the elimination of human errors associated with performing surveys of large areas. The system is designed such that surveys are performed at constant speed, the detector held at a set distance from the surface being surveyed, and survey data recorded automatically. In the dynamic mode, a precision wheel encoder is mounted to the

cart axle to determine distance traveled by the cart. The encoder can measure to a small fraction of a centimeter and is used to trigger the computer to capture data for every 5 cm of travel of the SCM cart. The result is count data (counts) for every 5 cm “bin” for every 5 cm of travel, or a matrix of 25 cm² “pixels” of data. In the static mode, a preset time is applied to the collection of data from a stationary detector. Data is binned in a manner similar to the dynamic mode.

Data is transferred from the SCM to a processing station containing the Survey Information Management Systems (SIMS) software via removable media. SIMS software is used to “stitch” the individual strips of data to create a single survey a survey unit or portion of a survey unit area. The data collected in 25 cm² “pixels” is summed with adjacent “pixels” in a manner that will result in the evaluation of every possible 100 cm² area. When determining activity, each 25 cm² “pixel” is 25 percent of four overlapping 100 cm² areas. This process ensures that small areas of activity above limits are not missed through grid registration errors.

2.7.1 Alpha Scan Measurements

The alpha emitting ROC is Ra-226. To achieve the sensitivity to detect at the release criteria for Ra-226, the SCM will operated on the alpha plateau and used in the recount mode, using two detectors hard mounted at a set distance from each other. Attachment 1 provides detailed information regarding the SCM/SIMS system compliance with RASO guidance regarding alpha scans for radium. The system will be operated at a target speed of 0.5 inch per second (inch/sec). The probability of detecting two or more counts due to a source is given by Equation 7-4 from the Management Plan ([TetraTech 2014a](#)) below.

$$P(n \geq 2) = 1 - \left(1 + \frac{(GE + B)t}{60} \right) e^{-\frac{(GE+B)t}{60}}$$

Where:

$P(n \geq 2)$ = probability of getting two or more counts during the time interval t

t = time interval of detector over source (second [sec])

G = source activity (dpm)

E = total efficiency ($\epsilon_i \times \epsilon_s$)

ϵ_i = detector efficiency

ϵ_s = surface efficiency

B = background count rate (count per minute [cpm])

60 = conversion factor, seconds to minutes

Since all detectors associated with the SCM are manufactured to the same specifications, the efficiency of each detector is similar. Therefore, the probability of obtaining two or more counts on each detector as they traverse the same 100 dpm source is the square of the probability for a single detector.

Typical background values observed with the SCM are less than 1 cpm/100 cm². Detector efficiency (2π) of the SCM for alpha emitters has been measured at greater than 100 percent, due to the SCM design which double counts physically small point sources. Surface efficiency is 0.25 percent as defined in Reference 2, Section 6.5.4. The detector width is 12 cm, although two pixels of 5 cm width, 10 cm total are used to collect data. Survey speed for alpha emitters is 1.25 centimeter per second (cm/sec) (0.5 inch/sec). Using these parameters, equation 7-4 from the Management Plan (TetraTech 2014a) becomes:

$$P(n \geq 2) = 1 - \left(1 + \frac{(100 * 0.25 + 1)8}{60} \right) e^{-\frac{(100 * 0.25 + 1)8}{60}}$$

Where:

$P(n \geq 2)$ = probability of getting two or more counts during the time interval t

$t = 8$ sec

$G = 100$ dpm

$E = 0.25$

$B = 1$ cpm

Therefore:

$$P(n \geq 2) = 0.8605 \text{ or } 86.05\%$$

The probability of both detectors responding with two or more counts from a point source of 100 dpm at a speed of 1.25 cm/sec (0.5 inch/sec) would be the square of a single detector, or:

$$P(n \geq 2)_{2 \text{ det}} = 74.05\%$$

2.7.2 Beta Scan Measurements

Beta scan surveys will be performed on the Building 20 Slab. For these beta surveys, the SCM will be the primary instrument. The ROC in the Class 3 area is Sr-90. In Class 3 areas, the SCM will be operated on the alpha plus beta plateau at a target speed of 2 inch/sec (5 cm/sec). For SCM scans for Sr-90 in Class 3 areas, the MDCR from Equation 7-5 of the Management Plan (TetraTech 2014a) is:

$$MDCR = d' \sqrt{b_i \left(\frac{60}{t} \right)}$$

Where: d' = index of sensitivity (α and β errors [performance criteria])
 b_i = number of background counts in scan time interval (counts)
 i = count time interval

Therefore:

$$MDCR = 3.28\sqrt{16.67} \left(\frac{60}{2}\right) = 402 \text{ cpm}$$

Where: $d' = 3.28$
 $b_i = 16.67$ counts (based on 500 cpm background and a 2 sec count interval)
 $i = 2$ sec (based on a scan speed of 5 cm/sec and a detector width of 10 cm.)

and the scan MDC from Equation 7-6 of the Management Plan ([TetraTech 2014a](#)) is:

$$\text{Scan MDC} = \frac{MDCR}{\sqrt{p} * \epsilon_i * \epsilon_s * \frac{W}{100 \text{ cm}^2}}$$

Where: MDCR = as discussed above
P = surveyor efficiency factor
 ϵ_i = instrument efficiency
 ϵ_s = surface efficiency
W = Area of the detector window (cm^2) [Defaults to 100 cm^2 for probes greater than 100 cm^2]

Therefore:

$$\text{Scan MDC} = \frac{402}{\sqrt{1} * 1.04 * .5 * \left(\frac{100}{100}\right)} = 773 \text{ dpm}$$

Where: $p = 1$
 $\epsilon_i = 1.04$
 $\epsilon_s = 0.5$
 $W_A = 100 \text{ cm}^2$

2.8 ALPHA AND BETA STATIC MEASUREMENTS

Alpha and beta static measurements will be obtained with both the SCM and the Ludlum 43-68 detector coupled to the Ludlum 2221 or 2241 scaler/ratemeter. The SCM static measurements will supplement the surveys performed in the dynamic or rolling mode when the rolling mode cannot get into areas such as on floors against the wall, or on walls where interferences make rolling surveys impractical. The Ludlum 43-68 detector will be used to obtain fixed measurements at the number of locations identified in [Section 2.5](#).

2.8.1 Alpha Static Measurements

The limiting alpha emitting ROC is Ra-226. Static counts for alpha emitting Ra-226 obtained with the SCM will utilize the detection probability approach similar to that for the SCM in the dynamic or scan method described in [Section 2.7](#). The SCM will use a single detector; however, 2 data acquisitions of 8 seconds each will be obtained at each location. The surveyor will place the detector against the surface to be surveyed and hold it steady for two 8 second counts. Data will be processed by creating 2 separate surveys of an area, the first 8 second count of each static measurement comprising the first data set and the second 8 second count, the second data set. The second data set will be over-laid on the first, and both sets evaluated for each 100 cm² area. Those 100 cm² areas in which both sets show a positive value above a prescribed threshold, will be indicative of an area potentially in excess of the release criteria. The SCM static count process assures that areas greater than the release criteria are detected at the same probability level as described in [Section 2.7.1](#) while suppressing false positives due to background. The approach is consistent with that of the SCM in the dynamic mode.

Direct measurements at predefined locations (See [Section 2.5](#)) and investigations will be performed with the Ludlum 43-68 gas proportional detector coupled to a Ludlum 2221 scaler/ratemeter. Static measurements for alpha emissions on the Building 20 Slab will require a 2 minute count time for the Ludlum 43-68 based on Ra-226. The MDC calculation for the specified count time from Equation 7-8 of the Management Plan ([TetraTech 2014a](#)):

$$MDC = \frac{3 + 3.29 \sqrt{R_B T_{S+B} \left(1 + \frac{T_{S+B}}{T_B}\right)}}{\epsilon_i \epsilon_s \frac{W_A}{100 \text{ cm}^2} T_{S+B}}$$

Where: R_B = Background count rate (cpm)

T_B = Background counting time (min)

T_{S+B} = Sample counting time (min)

ϵ_i = Instrument efficiency

ϵ_s = Surface efficiency

W_A = Active area of the probe window (Defaults to 100 cm² for probes greater than 100 cm²)

Therefore:

$$MDC = \frac{3 + 3.29 \sqrt{1 * 2 * \left(1 + \frac{2}{10}\right)}}{0.25 * 0.25 * \frac{100}{100 \text{ cm}^2} * 2}$$

$$MDC = 64.8 \text{ dpm}$$

Where:

$$R_B = 1 \text{ cpm}$$

$$T_B = 600 \text{ sec or } 10 \text{ min}$$

$$T_{S+B} = 120 \text{ sec or } 2 \text{ min}$$

$$\varepsilon_i = 0.25$$

$$\varepsilon_s = 0.25$$

$$W_A = 126 \text{ cm}^2 \text{ (areas greater than } 100 \text{ cm}^2 \text{ default to } 100 \text{ cm}^2)$$

2.8.2 Beta Static Measurements

Static measurement count times for the beta from the limiting ROC, Sr-90, will be 8 seconds for the SCM and 30 seconds for the Ludlum 43-68 with the 2221 or 2241 scaler/ratemeter. For the SCM surveying for Sr-90, the MDC, equation 7-8 from the Basewide Radiological Management Plan ([TetraTech 2014a](#)) becomes:

$$MDC = \frac{3 + 3.29 \sqrt{500 * .133 * \left(1 + \frac{.133}{.133}\right)}}{1.04 * 0.5 * \left(\frac{100}{100}\right) * .133} = 592 \text{ dpm}$$

Where:

$$R_b = 500 \text{ cpm}$$

$$T_{s+b} = 8 \text{ sec. or } .133 \text{ min}$$

$$T_b = 8 \text{ sec. or } .133 \text{ min}$$

$$\varepsilon_i = 1.04$$

$$\varepsilon_s = 0.5$$

$$W_A = 100 \text{ cm}^2$$

For the Ludlum 43-68 surveying for Sr-90, the equation becomes:

$$MDC = \frac{3 + 3.29 \sqrt{200 * .5 * (1 + \frac{.5}{.5})}}{.52 * .5 * (\frac{100}{100}) * .5} = 366 \text{ dpm}$$

Where: $R_b = 200 \text{ cpm}$
 $T_{s+b} = 30 \text{ sec. or } 0.5 \text{ min}$
 $T_b = 30 \text{ sec. or } 0.5 \text{ min}$
 $\epsilon_i = 0.52$
 $\epsilon_s = 0.5$
 $W_A = 100 \text{ cm}^2$

2.9 GAMMA WALKOVER SURVEYS

Gamma walkover surveys will be conducted in the survey unit with a 2" by 2" sodium iodide detector and a Ludlum 2241 scaler/ratemeter. Gamma readings will be obtained in accordance with Section 8.2.2 of the Basewide Radiological Management Plan ([TetraTech 2014a](#)). Surveys will be conducted in accordance with procedure SUR-022, *Gamma Walkover Surveys*.

2.10 REMOVABLE CONTAMINATION SURVEYS

Prior to the conduct of scanning surveys, removable contamination will be assessed by wiping the survey unit with a Masslin cloth on a suspect area and monitoring the swiped cloth with a Ludlum 43-68 detector coupled to a Ludlum 2221 scaler/ratemeter. Since both alpha and beta emitting nuclides are of concern, the Masslin cloth will be surveyed with detectors on the alpha plateau, then the alpha plus beta plateau. Areas in which the first swipe of the Masslin cloth indicates any increase in activity will be re-wiped with the Masslin cloth to determine the specific area that contains removable contamination. Swipe surveys using disc swipes will be conducted at any area indicating activity above background.

Swipe surveys will also be conducted in at least one location within each 1,000 ft² in a Class 3 survey unit, at each sink drain and at each of the systematic data collection locations. All swipe surveys will be counted onsite using a Ludlum 2929 detector which records both alpha and beta activity simultaneously. Swipe surveys will be performed and documented in accordance with SOP-006, *Radiation and Contamination Surveys*.

2.11 MEDIA SAMPLES

Samples will be collected if sediment is found in sumps, floor drains, and sink drains to support evaluation of compliance with release criteria and to determine specific nuclides as necessary. Sampling may also be performed as an integral part of investigations to determine the cause of elevated measurements. Samples will be collected in accordance with SOP-009, *Sampling*

Procedures for Radiological Surveys and submitted to an off-site laboratory for radiological analysis. One sediment sample per drain will be collected if sufficient sediment is present. Analysis of results will be evaluated against soil criteria identified in [Table 2](#).

Media samples will also be obtained at any accessible building outfall locations that would contain liquid runoff from the Building 20 Slab.

3.0 SITE RESTORATION

Site restoration work is not required at the conclusion of surveying on the Building 20 Slab.

4.0 BUILDING 20 SLAB REPORT

Results of the survey that demonstrate that no single measurement indicating activity greater than the release criteria, and the resultant risk based dose as calculated, will be presented in a survey report. Any conclusion other than a recommendation for unrestricted release will be presented in a Characterization Report.

5.0 QUALITY CONTROL

The data quality objectives for the survey are provided in [Table 3](#).

Definable features of work (DFW) establish the measures required to verify both the quality of work performed and compliance with project requirements. The DFW for this task is radiological surveys. Description of this DFW and the associated phases of quality control are presented in [Table 4](#).


6.0 ENVIRONMENTAL PROTECTION

Environmental protection requirements are addressed in the management plan ([TetraTech 2014a](#)).

7.0 REFERENCES

- Department of Energy (DOE). 2014. *Visual Sample Plan*. Upgrade version 7.0 released 2014. Pacific Northwest National Laboratory.
- Nuclear Regulatory Commission (NRC). 2000. NUREG-1575, *Multi-Agency Radiation Survey and Site Investigation Manual (MARSSIM)*, Rev. 1. August.
- Tetra Tech, Inc. (TetraTech) 2014a. *Basewide Radiological Management Plan, Naval Air Station Joint Reserve Base Willow Grove, Willow Grove, Pennsylvania*. March.
- Tetra Tech, Inc. (TetraTech) 2014b. *Health and Safety Plan for Base Wide Radiological Surveys, Naval Air Station, Naval Air Station Joint Reserve Base Willow Grove, Willow Grove, Pennsylvania*. May.
- Tetra Tech, Inc. (TetraTech) 2013. Draft *Historical Radiological Assessment, Naval Air Station Joint Reserve Base Willow Grove, Willow Grove, Pennsylvania*. July.

FIGURES

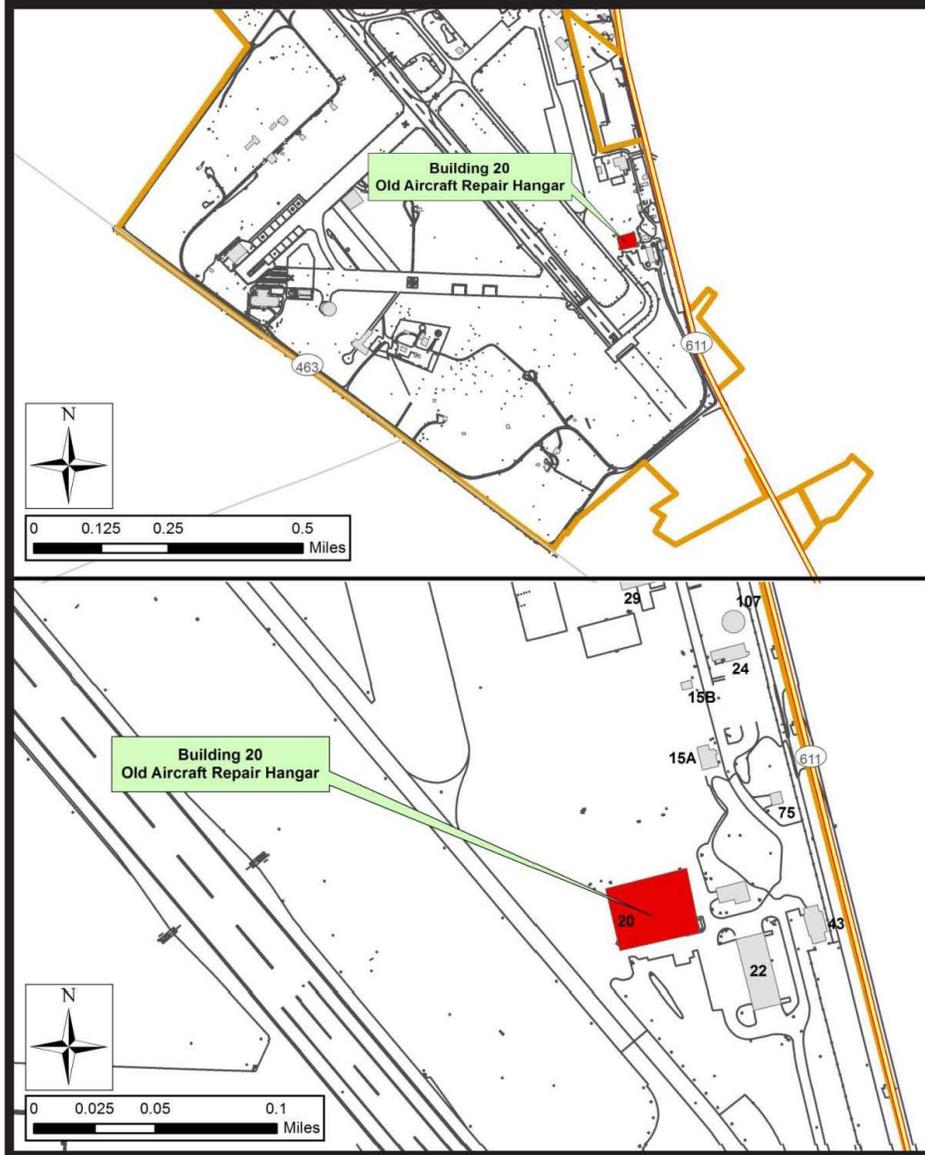



Willow Grove NAS/JRB, Horsham, Penn.
 U.S. Dept. of the Navy, BRAC PMO East, Philadelphia, Pennsylvania

Building 20 (Slab)
 Site Location
 FIGURE 1

Drawing To Scale

Rev 0

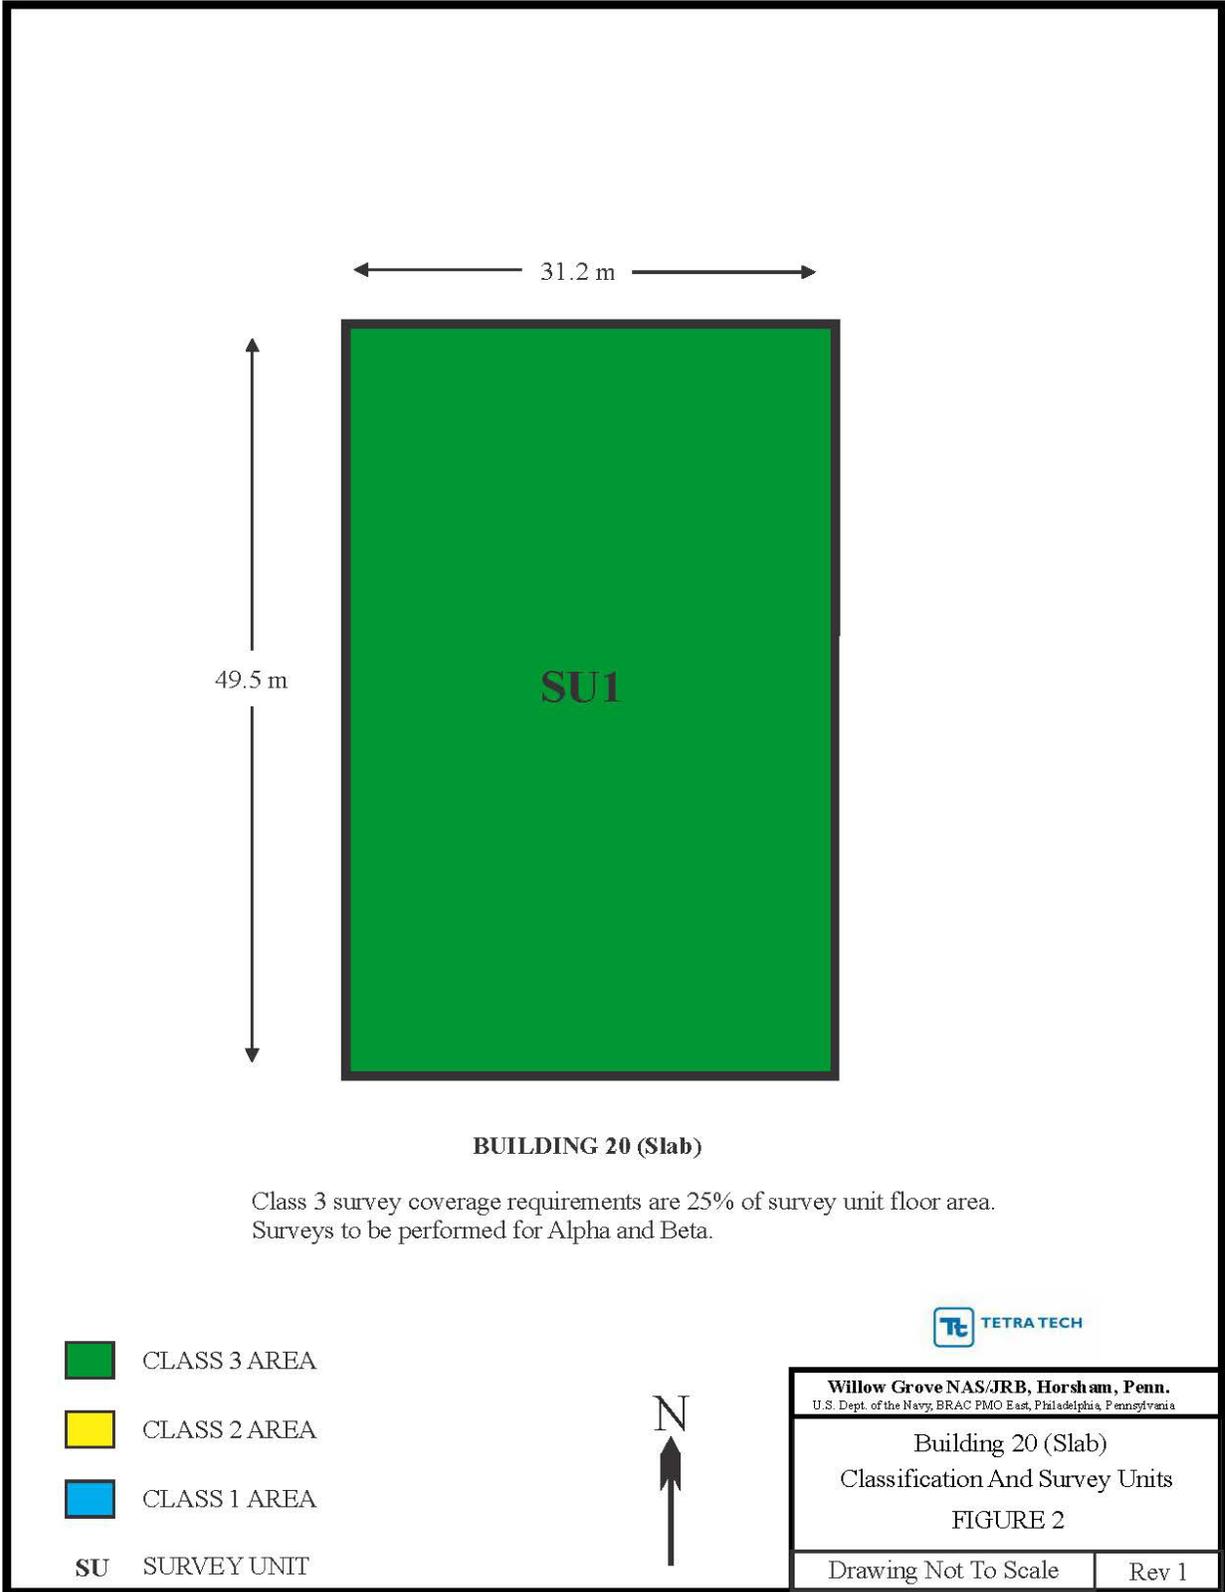

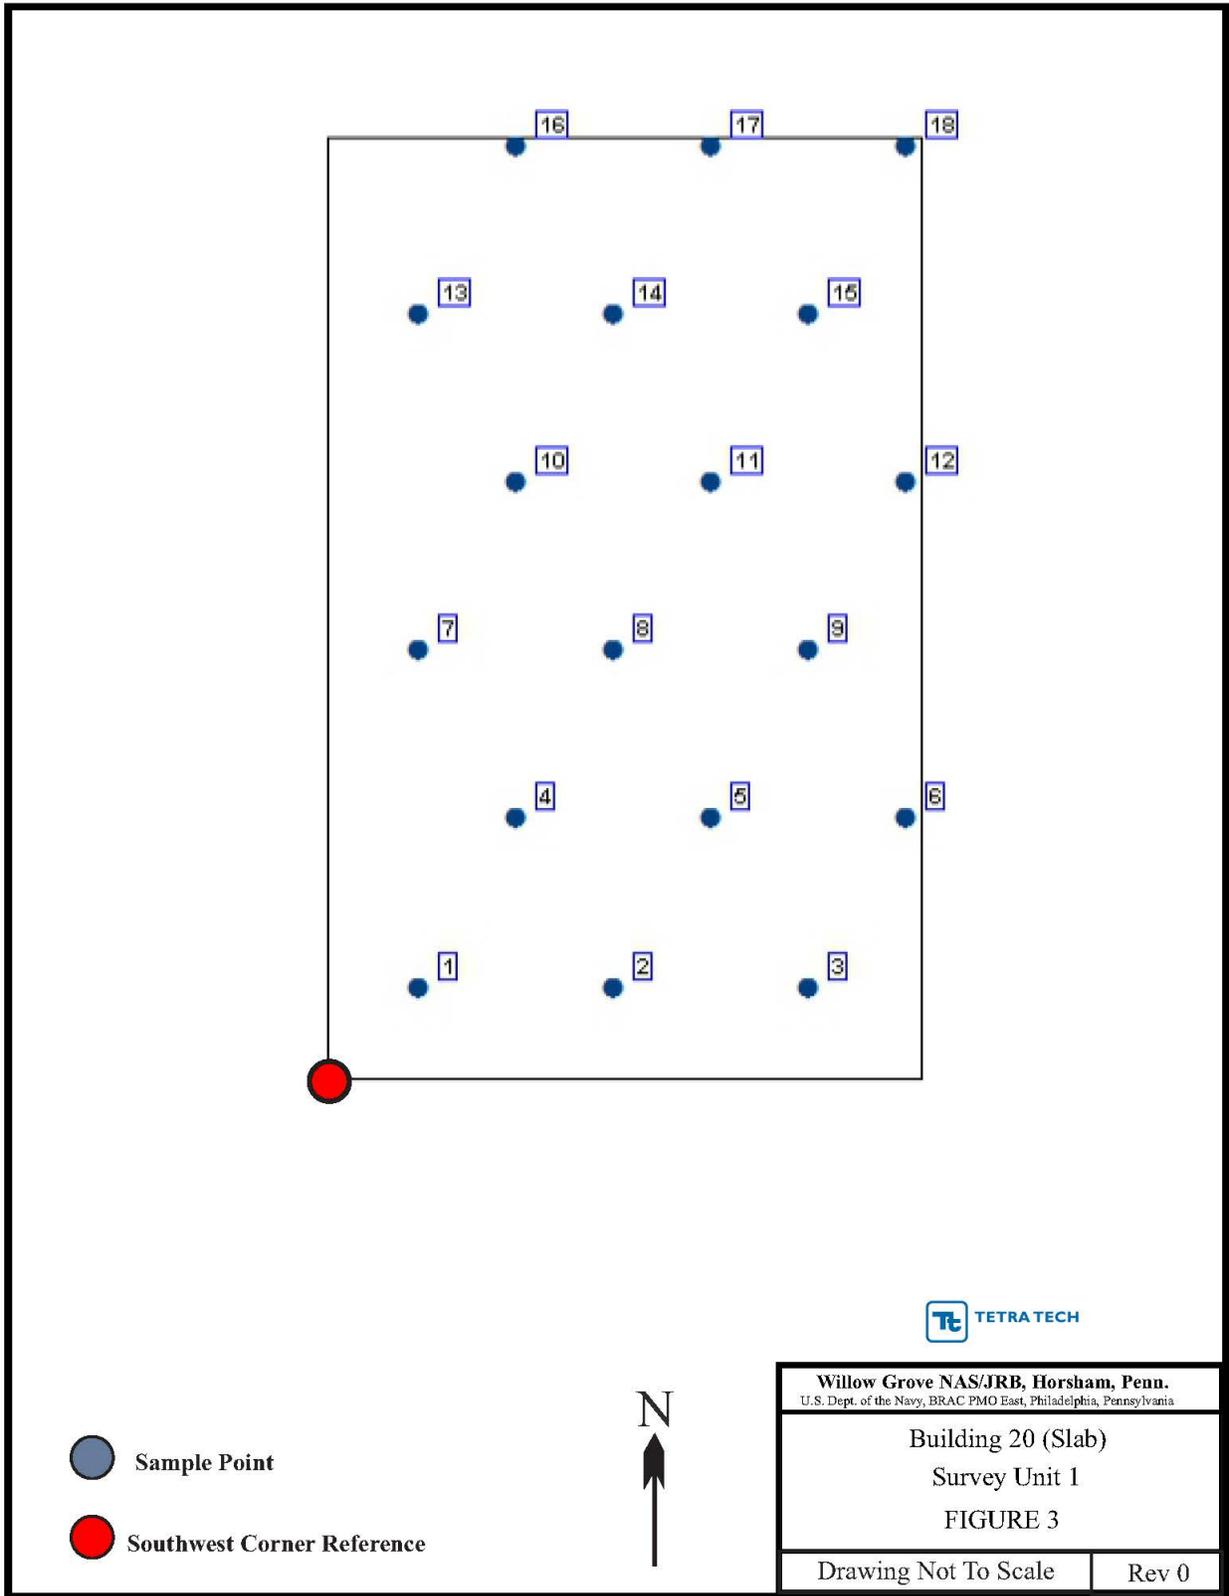

TABLES

TABLE 1 BUILDING 20 SLAB APPLICABLE STANDARD OPERATING PROCEDURES

Procedure	Title	Rev
SOP 002	Radiation Work Permits	0
SOP 004	Project Dosimetry	0
SOP 006	Radiation and Contamination Surveys	0
SOP 007	Preparation of Portable Radiation and Contamination Survey Meters for Field Use	0
SOP 008	Air Sampling and Sample Analysis	0
SOP 009	Sampling Procedures for Radiological Surveys	0
SOP 010	RCA Posting and Access Control	0
SOP 011	Control of Radioactive Materials	0
SOP 012	Release of Materials and Equipment	0
SOP 016	Decontamination of Equipment and Tools	0
SOP 022	Radiological Clothing Selection, Monitoring and Decontamination	0
SOP 023	Source Control	0
SOP 024	Occurrence Reporting	0
SUR 022	Gamma Walkover Surveys	0
RP-OP-017	Operation of the Ludlum Model 2929 Dual Scaler	0
RP-OP-025	Operation of the Ludlum Model 2221	0
RP-OP-026	Operation of the Ludlum Model 19	0
SCM-OPS-01	Position Sensitive Proportional Counters Purging	0
SCM-OPS-02	Position Sensitive Proportional Counters Plateau Determination	0
SCM-OPS-03	Position Sensitive Proportional Counters Position Calibration	1
SCM-OPS-04	Encoder Calibration	0
SCM-OPS-05	Position Sensitive Proportional Counters Efficiency Calibration	0
SCM-OPS-06	Position Sensitive Proportional Counters Quality Assurance	1
SCM-SETUP-01	Position Sensitive Proportional Counters Repair	0
SCM-SETUP-02	Hardware Setup	0
SCM-SETUP-03	Quality Assurance Testing of SCM	0

TABLE 2 BUILDING 20 SLAB PRIMARY RADIATION PROPERTIES AND RELEASE CRITERIA FOR RADIONUCLIDES OF CONCERN

Radionuclide	Primary Radiation Properties		Release Criteria ^a				
	Half-Life	Type	Materials & Equipment		Building Surfaces		Soil ^b
			Total Surface Activity	Removable Activity	Total Surface Activity	Removable Activity	Activity (pCi/g)
Sr-90	3.01E01 Years	Beta	1,000	200	1,000	200	1.02
Ra-226	1.60E03 years	Alpha	100	20	100	20	1.0

Notes:

- a Units are disintegrations per minute per 100 square centimeters, unless otherwise specified.
- b Criteria is above background for those radionuclides found in background soils.

Ra-226 Radium 226
 Sr-90 Strontium 90

Source: [TetraTech 2014a](#). Basewide Radiological Management Plan, Naval Air Station Joint Reserve Base Willow Grove, Willow Grove, Pennsylvania.

TABLE 3 SUMMARY OF DATA QUALITY OBJECTIVES

STEP 1 Statement of Problem	STEP 2 Decisions	STEP 3 Inputs to the Decisions	STEP 4 Boundaries of Study	STEP 5 Decision Rules	STEP 6 Limits on Decision Errors	STEP 7 Optimizing the Sampling Design
<p>Building 20 Slab is listed in the HRA as an area impacted by radiological activities. The isotopes of concern are Sr-90 and Ra-226.</p> <p>It must be determined if the site-specific release criteria for these isotopes have been met or if remediation or further survey is warranted.</p>	<p>The primary use of the data expected to result from completion of this TSP is to support the Scoping Survey of the Building 20 Slab.</p> <p>Therefore the decision to be made can be stated as “Do the results of the survey indicate activity above background or meet the release criteria?”</p>	<p>Radiological surveys required to support the Final Status Survey of the Building 20 Slab will include:</p> <ul style="list-style-type: none"> • 25 percent scan surveys of Class 3 areas • A minimum of 17 systematic static measurements will be performed in Class 3 areas • One swipe per 1,000 square feet in Class 3 survey units • One sediment sample will be collected from each drain if available. • One swipe at each systematic sample location 	<p>The lateral and vertical spatial boundaries for this survey effort are confined to the Building 20 Slab.</p>	<p>If the concentration of radioactivity on building surfaces, paved areas, or in sediment samples is less than the release criteria, then no further measurements are required.</p> <p>If the results of the survey exceed the release criteria, then the building will be investigated further.</p>	<p>Limits on decision errors are set at 5 percent as specified in the management plan (TetraTech 2014a).</p>	<p>Operational details for the radiological survey process have been developed. The theoretical assumptions are based on guidelines contained in MARSSIM (NRC 2000). Specific assumptions regarding types of radiation measurements, instrument detection capabilities, quantities and locations of data to be collected, and investigation levels are contained in this TSP and the management plan (TetraTech 2014a).</p>

Notes:

- HRA Historical Radiological Assessment
- MARSSIM Multi-Agency Radiation Survey and Site Investigation Manual
- NRC Nuclear Regulatory Commission Ra-226 Radium 226
- Sr-90 Strontium 90
- TSP Task Specific Plan

TABLE 4 DEFINABLE FEATURES OF WORK FOR RADIOLOGICAL SURVEYS

ACTIVITY	PREPARATORY (Prior to initiating survey activity)	DONE	INITIAL (At onset of survey activities)	DONE	FOLLOW-UP (Ongoing during survey activities)	DONE
Radiological Surveys	<ul style="list-style-type: none"> • Verify that an approved TSP is in place. • Verify that the Remedial Project Manager and the Caretaker Site Office are notified about mobilization. • Verify that an approved Radiation Work Permit, if required, is available and has been read and signed by assigned personnel. • Verify that the management plan, HASP and TSP, have been reviewed. • Verify that personnel assigned are trained and qualified. • Verify that personnel have been given an emergency notification procedure. • Verify that workers assigned dosimeter have completed NRC Form 4. • Verify that relevant SOPs are available and have been reviewed for equipment to be used. • Verify that equipment is on site and in working order (initial daily check). 		<ul style="list-style-type: none"> • Verify that radiological instruments are as specified in the management plan (TetraTech 2014a) and TSP. • Inspect Training Records. • Verify that reference area measurements have been obtained in accordance with the management plan (TetraTech 2014a). • Verify that daily checks were performed on all survey instruments. • Verify that instrument calibration and setup are current. • Verify that required dosimeter is being worn. • Verify that field logbooks and proper forms are in use. • Verify that samples and measurements are being collected in accordance with the TSP, management plan and applicable SOPs. • Verify the sample handling is in accordance with the management plan (TetraTech 2014a) and applicable SOPs. 		<ul style="list-style-type: none"> • Verify that the site is properly posted and secured. • Conduct ongoing inspections of material and equipment. • Verify that daily instrument checks were obtained and documented. • Verify that survey results were documented. • Inspect chain-of-custody and survey logs for completeness. • Verify that survey activities conform to the TSP. • Verify that survey instruments are recalibrated after repairs or modifications. 	

Notes:

- HASP Health and Safety Plan
- NRC Nuclear Regulatory Commission
- SOP Standard Operating Procedure
- TSP Task Specific Plan

ATTACHMENT 1

**SURFACE CONTAMINATION MONITOR/SURVEY INFORMATION
MANAGEMENT SYSTEM
COMPLIANCE WITH RASO GUIDANCE DOCUMENT
CONDUCTING ALPHA SCANS FOR RADIUM**

MILLENNIUM SERVICES, INC.

Leading the way...

**Surface Contamination Monitor/Survey Information
Management System
Compliance with RASO Guidance Document
Conducting Alpha Scans for Radium**

May 2014

Prepared By:

Original Signed By
Richard W. Dubiel, CHP

Surface Contamination Monitor/Survey Information Management System Compliance with RASO Guidance Document Conducting Alpha Scans for Radium

RASO has issued a guidance document for conducting alpha scans for radium-226 (RASO 2013). The document follows the protocols established in MARSSIM (NRC 2000). Since Ra-226 is an alpha emitter that is assigned a low release criterion by Navy standards, the detection process must rely on Probability of Detection Theory to determine the ability of an instrument to detect elevated areas of alpha activity during the scanning process. Specifically, the Navy has imposed acceptance criteria of 100 dpm/ 100 cm². Because of the low emission rate at this level of activity of Ra-226, the recommended process is to slowly scan at rates no greater than ½ inch per second and listen for audible clicks. Typically more than one click within the detector area will indicate the potential that Ra-226 at the release limit is present. The area must be marked or immediately investigated with longer, static counts. The probability of detecting 2 or more counts in a scan interval is defined by equations found in Appendix J to MARSSIM (NRC 2000) and provided in the RASO guidance (RASO 2013).

RASO guidance (RASO 2013) recommends that equipment and scan speed be chosen such that there is a 90% probability of detecting a 100 dpm/100 cm² source. A minimum probability of 68% detection is included. Inherent in the guidance is that false positives from background in materials such as concrete or asphalt will occur a significant percent of the time and can be predicted by Poisson statistics. The Surface Contamination Monitor (SCM) and Survey Information Management System (SIMS) are capable of scanning surveys that meet the detection probability requirements and significantly reduce the number of false positives from material background that subsequently require investigation.


The SCM is an automated system utilizing a DC motor drive to control scan speed, a precision wheel encoder to measure relative location, large area position sensitive detectors with offsets to maintain constant detector to surface distance, and a computer to record count rate data and system speed. The large area detectors are Position Sensitive Proportional Counters (PSPC) with lengths up to 180 cm, and width of 12 cm. The SCM utilizes a gas flow position sensitive proportional counter (PSPC). The PSPC functions as any gas flow proportional counter, using P-10 as the counting gas. As in any proportional counter, voltage plateaus are established for the detection of alpha or alpha plus beta particles. High voltage appropriate for the type of particles to be detected is applied to the single anode wire which runs the length of the detector. The SCM computer compares the pulse heights of pulses sensed at each end of the anode wire and establishes the location on the anode wire where the pulsed was sensed. Although the available resolution is greater than 2,000 locations on the anode wire, the SCM computer will “bin” the data in 5 centimeters (cm) wide increments along the length of the wire.

The SCM can be operated in both a dynamic or “rolling” mode or a static or “corner” mode. In the dynamic mode, the system uses a direct current powered drive motor affixed to a cart

which contains all electronics and computer hardware, and to which a detector (or two) is mounted. The SCM's design focuses on the elimination of human errors associated with performing surveys of large areas. The system is designed such that surveys are performed at constant speed, the detector maintained at a set distance from the surface being surveyed, and survey data recorded automatically. In the dynamic mode, a precision wheel encoder is mounted to the cart axle to determine distance traveled by the cart. The encoder can measure to a small fraction of a centimeter and is used to trigger the computer to capture data for every 5 cm of travel of the SCM cart. The result is count data (counts) for every 5 cm "bin" and every 5 cm of travel, or a matrix of 25 cm² "pixels" of data. In the static mode, a preset time is applied to the collection of data from a stationary detector. Data is binned in a manner similar to the dynamic mode.

Data is transferred from the SCM to a processing station containing the Survey Information Management System (SIMS) software via removable media. SIMS software is used to "stitch" the individual strips of data to create a single survey of an entire area. The data collected in 25 cm² "pixels" is summed with adjacent "pixels" in a manner that will result in the evaluation of every possible 100 cm² area. When determining activity, each 25 cm² "pixel" is 25 percent of four overlapping 100 cm² areas. This process ensures that small areas of activity above limits are not missed through grid registration errors.

Each 25 cm² pixel is part of 4 overlapping 100 cm² areas

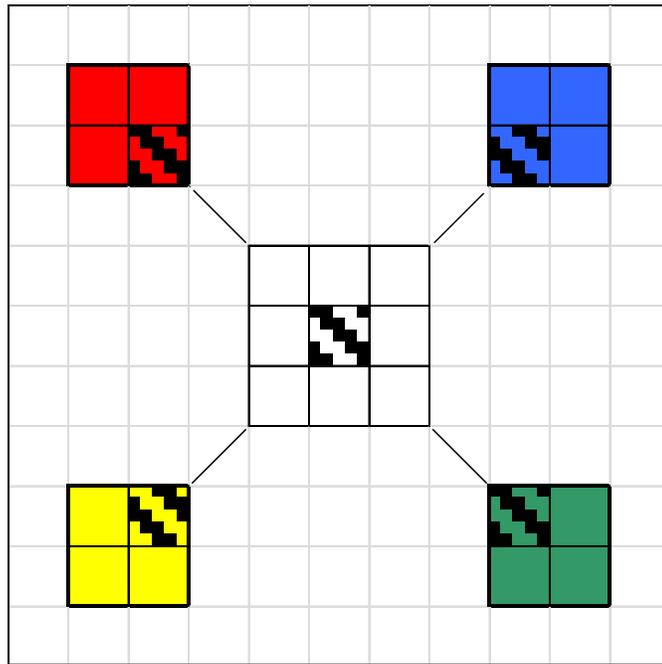

Performance of alpha scan surveys includes the use of a second or "recount" detector hard mounted at a set distance behind the primary detector. The recount detector records a second set of data for the same area surveyed by the primary detector, with both data sets filed on the SCM computer and subsequently transferred to SIMS. The recount survey acts as an automated "investigation" of all 100 cm² areas surveyed by the primary detector. The

calculations below are designed to show that SCM/SIMS is capable of meeting the probability of detection guidance of the RASO guidance (RASO 2013) and greatly reducing the number of false positives due to material background.

Calculations

Efficiency values have been determined using a NIST traceable thorium 230 (Th-230) source. The source is a 5 mm diameter source, more like a point source than a distributed source. The physical size of the source provides a better approximation of the size that would be represented by a 100 dpm Ra-226 spot. The specific activity of Ra-226 is 1 Curie per gram, therefore 100 dpm would be 4.5×10^{-11} grams of Ra-226.

Due to the physical size of the source, the data accumulation in 25 cm^2 “pixels”, and the summing of 4 adjacent “pixels” as described above creating a 100 cm^2 area data entry, the count rate from the NIST traceable source would be doubled. The result is an efficiency far greater than other proportional counters. Demonstrated 2π detector efficiencies (ϵ_i), exceed 100%. Surface efficiency (ϵ_s) is 0.25 as stated in the RASO guidance document (RASO 2013).

Alpha background values from concrete and asphalt surfaces vary greatly based on materials from various regions of the US, various sources within a specific area, and even locations within a quarry. Background can also be affected by radon progeny on the surface. Experience has shown that typical alpha backgrounds measured by the SCM are less than 1 cpm per 100 cm^2 .

Probability of detection equations are found in the RASO guidance (RASO 2013) and MARSSIM (NRC 2000), Appendix J. The SCM will identify a positive indication based on 2 or more counts in a 100 cm^2 area. The equation applied to the SCM survey is:

Equation 1

$$P(n \geq 2) = 1 - e^{-\frac{(GE+B)t}{60}} \left[1 + \frac{(GE + B)t}{60} \right]$$

Where: P = Probability of Detecting counts (n)

B = background count rate (cpm)

G = hot spot activity (dpm)

E = total efficiency ($\epsilon_i \times \epsilon_s$)

ϵ_i = detector efficiency (2π)

ϵ_s = surface efficiency (0.25)

t = resident time (sec.)

The following parameters are used to calculate the probability of getting 2 or more counts in a 100 cm² area from a 100 dpm hot spot on a single PSPC detector scanning at ½ inch per second:

$$B = 1 \text{ cpm}$$

$$G = 100 \text{ dpm}$$

$$E = 0.25$$

$$\varepsilon_i = 1.00$$

$$\varepsilon_s = 0.25$$

$$t = 8 \text{ sec (two 5 cm long pixels, 1.25 cm/sec scan speed)}$$

SIMS computer analysis tools allow for the evaluation of both the primary and recount as separate surveys and evaluation of the two surveys in a coincidence mode. Each 100 cm² area surveyed by both detectors is evaluated against a threshold value of 2 or more counts. If both detectors indicate greater than 2 or more counts, the calculated activity from each detector is averaged and identified in the coincidence count display and data table. If either primary or recount detector indicates less than 2 counts, a null value is identified in the coincidence display and data table.

Since the recount detector is hard mounted to the primary detector, the scan speed will be identical. PSPC efficiencies are very similar and all tested have exhibited 2π efficiencies of greater than 1.00. The probability of detection will be the same on both detectors. Therefore, the probability of getting 2 or more counts in a 100 cm² area from a 100 dpm hot spot on both detectors is the square of the probability from a single detector.

In order to calculate the false positive rate, i.e. the probability of identifying "contamination" above a certain value, while only background is present, the same formula can be used. Setting the hot spot value to zero will provide the probability of getting 2 or more counts in a 100 cm² area from 1 cpm background on a single PSPC detector scanning at ½ inch per second. Again, the probability of getting 2 or more counts in a 100 cm² area from 1 cpm background on both detectors is the square of the probability from a single detector.

When used in the static mode, the detector is placed on the surface with a computer controlled preset counting time. A single detector is used with the detector remaining stationary for 2 data acquisitions. A full survey in the static mode will result in many "strips" of data. SIMS processing will create two complete surveys, using alternating data strips for the primary and recount surveys. Coincidence analysis is applied in the same manner as described above. The counting time is set at 8 seconds for each acquisition and the instrument efficiency is similar to that determined for the dynamic mode. Therefore probability of detection calculations will be the same for both the dynamic and static modes of operation.

The results of applying both the 100 dpm/100 cm² hot spot and the zero hot spot and 1 cpm background to the probability of detection equation are as follows:

SCM Probability of Detection for Surface Alpha Activity		
G Hot Spot Value	P(n ≥ 2) Single PSPC Detector	P(n ≥ 2) Primary and Recount PSPCs
100 dpm/100 cm ²	0.861 (86%)	0.741 (74%)
0	0.008	6.62E-05

Conclusion

The SCM/SIMS process uses an automated data collection process to minimize human errors associated with surveys for low activity alpha emitting radionuclides. Using a second detector, in recount mode of data collection, provides an ongoing means of investigation for small count rates that may be a result of surface background. The SCM/SIMS system provides two separate surveys of the same area, allowing for spatial coincidence analysis of the data. The SCM/SIMS system is sufficiently sensitive to meet the RASO guidance for alpha scanning for radium-226 while providing a computerized analysis of the results from the two surveys to greatly reduce the number of investigations required from natural activity that may be on or in the surface material.

REFERENCES

NRC (Nuclear Regulatory Commission). 2000. NUREG-1575, *Multi-Agency Radiation Survey and Site Investigation Manual (MARSSIM)*, Rev. 1. August.

RASO (Radiological Affairs Support Office). 2013. *RASO Guidance Document – Conducting Alpha Scans for Radium, Final*. December